## INSTALLATION INSTRUCTIONS

## Please Note Before Installation

Hardware Resource Company (HRC) cannot control the use or installation of add-on, spare, or replacement parts. Therefore, HRC shall have no responsibility for injury or damage resulting from improper installation or other misuse. Parties undertaking use of these parts assume full responsibility for following proper installation procedures.

## Instructions for installing replacement connecting hardware kits.

- Ensure all electrical power and voltage has been turned off, locked off, and tagged out. Do not attempt
  to install product into a switchboard or panelboard while energized. Installation of this product should
  be performed by qualified personnel only.
- After electricity has been locked off and tagged out, confirm that no electrical current is present by using a calibrated voltage detection instrument.
- Remove dead front cover plates as necessary to gain access to work area

4.

- De-energized bus bar should now be exposed. Install the B phase (center phase) connector first. Tighten screws or bolts to finger tight at this point.
- Install out side phase connector(s), and tighten with fingers.
- 6.) Install bus bar anti-turn devices if provided. (Not all kits utilize anti-turn devices.)
- Install circuit breaker or switch mounting brackets if provided.
- 8.) If available, place the circuit breaker or switch into its intended location to verify proper alignment and fit. If not available, refer to the attached assembly drawings for proper dimensions and locations of components parts. (Circuit breaker or switch is not included in this kit.)
- 9.) After proper alignment has been verified, tighten all bus connections with a calibrated torque wrench to the values listed in table to the right. Check to be sure there are no visible obstructions or foreign materials present that might reduce proper electrical clearances, or damage insulated conductors. Remove any obstructions or foreign materials before continuing.
- If available, install circuit breaker or switch onto connectors.
   If not available, go to step 11.
- Install circuit breaker or switch filler plates when provided.
   (Some may not be required with twin-mounted breakers)
- Re-install dead front cover plates. Do not re-energize the switchboard or panelboard without first following all safety and procedural practices necessary to ensure it is safe to re-apply power to the equipment. Only qualified personnel shall re-energize any switchboard or panel board.

12.)

| 1/2    | 3/8   | 5/16  | 1/4   | #10 | Bolt Size<br>Inch, (mm) | Torqu<br>Alun   |
|--------|-------|-------|-------|-----|-------------------------|---|
| (12.7) | (9.5) | (7.9) | (6.4) |     | ize<br>(mm)             | າe Value<br>າinum B                                     |
| 600    | 240   | 128   | 65    | 30  | Torque<br>lb, - in.     | Torque Values for Copper or<br>Aluminum Bar Connections |

## NOTICE


THE USE OF THE ORIGINAL EQUIPMENT MANUFACTURER'S TRADEMARK IS FOR INFORMATIONAL PURPOSES ONLY AND DOES NOT REPRESENT AN ENDORSEMENT OF THIS PRODUCT BY THE MANUFACTURER.



| GENERAL ELECTRIC<br>150AMP MOUNTING H.<br>SEDA, SEHA, SELA,<br>IN APN TYPE PANÉL |
|--|
| ARDWARE FOR<br>SEPA BREAKE<br>TWIN MOUNT   |
| Z A  |

DRAWING NO. LAYER
DWARE FOR PA BREAKERS KIT NO. 21-D137SED F

BREAKER DR SWITCH

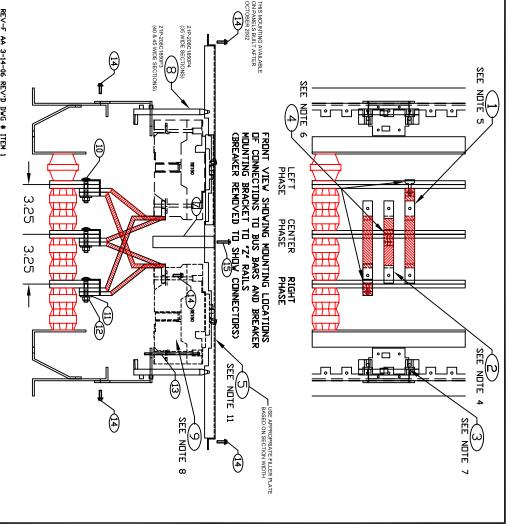

| <del>-</del> ω | 2 Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω Ω | TEMS 5 & 1 & 2 & 2 & 2 & 2 & 2 & 2 & 2 & 2 & 2 |  | G #XS FI | DAC #11<br>DAC #11<br>DAC DESC |  | 1-28-04<br>3-29-03<br>3-1-03 R | / \- I | \$\$\$\$\$<br>\$\delta\delt | RRRRRR<br><<<<< |  |
|----------------|---|--|--|----------|--------------------------------|--|--------------------------------|--------|---|-----------------|--|
|----------------|---|--|--|----------|--------------------------------|--|--------------------------------|--------|---|-----------------|--|

|            |                            | 6                 |                  |
|------------|----------------------------|-------------------|------------------|
| ITEM QTY.  | DESCRIPTION                | DWG No.           | MBLI             |
| <u>(</u> ) | A & C PHASE CONNECTORS     | 21J-D137SED-03-01 | (=)              |
| (A)        | B PHASE CONNECTOR          | 21J-D137SED-02-02 | (                |
| (a)<br>~   | BREAKER MOUNTING BRACKET   | 21M-D7APN-01      | (F)              |
| (န)<br>သ   | PHASE ANTI TURN DEVICE     | 21S-AT10-02       | (a)              |
| (G)<br>    | DEAD FRONT/FILLER PLATE 35 | 21F-D137SED-00-35 | ( <del>-</del> ) |
| (G)<br> -  | DEAD FRONT/FILLER PLATE 40 | 21F-D137SED-00-40 | ( <del>5</del> ) |
| G<br>-     | DEAD FRONT/FILLER PLATE 45 | 21F-D137SED-00-45 | 0                |
| 6          | DEAD FRONT/FILLER BLANK    | 21F-D7APN1B-00    | 0                |
| 0          | FILLER INSULATION BARRIER  | 21P-252B1667P1    | 0                |
| ⊚<br>∾     | FILLER MOUNTING BRACKET    | 21P-208C1850P3    | 0                |
| (e)<br>N   | FILLER MOUNTING BRACKET    | 21P-208C1850P4    | 0                |

| Ξ | WIY. |                             | JWG No.       |
|---|------|-----------------------------|---------------|
| 2 | 3    | ¼-20 × 1½° CARRIAGE BOLT    |               |
| 2 | 3    | 1/4-20 FLAT WASHER          |               |
| 2 | 3    | 1/3-20 STAR HEX NUT         | 21H-137SED-01 |
| 4 | 4    | 156 X 316" ROUND HEAD SCREW |               |
| У | 12   | 1%e X %' SELF TAP BOLT      |               |
| 2 | 2    | 1%2 X 34" ROUND HEAD SCREW  |               |
| v |      |                             |               |
| V |      |                             |               |
| V |      |                             |               |
| V |      |                             |               |
| V |      |                             |               |
| 4 |      |                             |               |